



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	275	Date:	10/12/2004	MeterBasin:	01_WR32
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	8	Setup No:	4	Priority CCTV:	

House Number	7026	Street Prefix:		Street Name:	Fieldcrest	Street Type:	ROAD
Source Type:	04= Cleanout	Location:	5=Sidewalk	Severity:	4=Major		
Sector:	2=Private	Drainage Area:	0				
Comments:							

SMOKE TEST PHOTOS



Photo No:
Filename Path:

Image Status: No image name specified.

Photo No: 516

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1012-2004\T-2\PLAYER_B\B_2004_1012Image0516.JPG

Image Status: Image found and displayed.

Photo No:
Filename Path:

Image Status: No image name specified.

SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 15
Setup No. 9

BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM

275

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/12/04	Start Time: 1540
Crew: T2	Street Location: Field Crest Rd		
US MH: 1521321	DS MH: 1521713	Number of Segments: 8	Test Length: 1687'
Plugged US: <input checked="" type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> N	# of Blowers: 1 2 3	Ground: <input checked="" type="checkbox"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="checkbox"/> N	Recorder: Bob Blank	Comments:	
FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)			

CREW COMMENTS
Did not get good enough smoke until the blower was put at 1521701. Possible blockage upstream?

Last Revised 9/16/2004

Leader Form

Sketch No:

275

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\275.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	275	Date:	10/12/2004	MeterBasin:	01_WR32
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	Y
Defect No:	9	Setup No:	4	Priority CCTV:	

House Number	3900	Street Prefix:		Street Name:	Glengyle	Street Type:	AVE
Source Type:	14= Catch Basin	Location:	7=Yard-Front	Severity:	4=Major		
Sector:	1=Public	Drainage Area:	5000				
Comments:	west corner						

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 517

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1012-2004\T-2\PLAYER_B\B_2004_1012Image0517.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.

SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 15
Setup No. 9

BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM

275

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/12/04	Start Time: 1540
Crew: T2	Street Location: Field Crest Rd		
US MH: 1521321	DS MH: 1521713	Number of Segments: 8	Test Length: 1687'
Plugged US: <input checked="" type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> N	# of Blowers: 1 2 3	Ground: <input checked="" type="checkbox"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="checkbox"/> N	Recorder: Bob Blank	Comments:	
FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)			

Sketch No:

275

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\275.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	276	Date:	10/12/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	1	Setup No:	1	Priority CCTV:	

House Number	3703	Street Prefix:		Street Name:	Seven Mile	Street Type:	LANE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate		
Sector:	2=Private	Drainage Area:	50				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 5

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1012-2004\T-3\PLAYER_A\A_2004_1012Image0005.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 26
Setup No. 1
276

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-12-04	Start Time: 1345
Crew: T3	Street Location: SEVEN MILE CR.		
US MH: 1522056	DS MH: 1522651	Number of Segments: 9	Test Length: 1,922'
Plugged US: Y <u>N</u>	Plugged DS: Y <u>N</u>	# of Blowers: 1 2 <u>3</u>	Ground: <u>Dry</u> Moderate Wet
Plugs Removed? Y <u>N</u>	Recorder: <i>[Signature]</i> JDE P. 10/12/04	Comments: CNF 1522059	
FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)			

CREW COMMENTS

• CNF 1522059

• OUT GOING LINE FROM 1522467 HAS STICKS CREATING A GRAVIL BLOCKAGE. HAD TO SET UP SMALL BLOWER ON 1522467

Last Revised 9/16/2004Leader Form

Sketch No:

276

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\276.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	276	Date:	10/12/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	2	Setup No:	1	Priority CCTV:	

House Number	3715	Street Prefix:		Street Name:	Seven Mile	Street Type:	LANE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate		
Sector:	2=Private	Drainage Area:	0				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 6

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1012-2004\T-3\PLAYER_A\A_2004_1012Image0006.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 26
Setup No. 1
276

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-12-04	Start Time: 1345
Crew: T3	Street Location: SEVEN MILE CR.		
US MH: 1522056	DS MH: 1522651	Number of Segments: 9	Test Length: 1,922'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: [Signature]	Comments: CNF 1522059	
FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)			

CREW COMMENTS

• CNF 1522059

• OUT GOING LINE FROM 1522466 HAS STICKS CREATING A GRAVIL BLOCKAGE. HAD TO SET UP SMALL BLOWER ON 1522467

Last Revised 9/16/2004Leader Form

Sketch No:

276

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\276.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	276	Date:	10/12/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	3	Setup No:	1	Priority CCTV:	

House Number	3717	Street Prefix:		Street Name:	Seven Mile	Street Type:	LANE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	2=Trace		
Sector:	2=Private	Drainage Area:	0				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 7

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1012-2004\T-3\PLAYER_A\A_2004_1012Image0007.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 26
Setup No. 1
276

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-12-04	Start Time: 1345
Crew: T3	Street Location: SEVEN MILE CR.		
US MH: 1522056	DS MH: 1522651	Number of Segments: 9	Test Length: 1,922'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: [Signature]	Comments: CNF 1522059	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

- CNF 1522059
- OUT GOING LINE FROM 1522466 HAS STICKS CREATING A GRAVIL BLOCKAGE. HAD TO SET UP SMOKE BLOWER ON 1522467

Last Revised 9/16/2004 Leader Form

Sketch No:

276

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\276.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	276	Date:	10/12/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	4	Setup No:	1	Priority CCTV:	

House Number	3801	Street Prefix:		Street Name:	Seven Mile	Street Type:	LANE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate		
Sector:	2=Private	Drainage Area:	50				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 8

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1012-2004\T-3\PLAYER_A\A_2004_1012Image0008.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.

SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 26
Setup No. 1

BUREAU OF WATER AND WASTEWATER SMOKE TEST INSPECTION FORM

276

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-12-04	Start Time: 1345
Crew: T3	Street Location: SEVEN MILE CR.		
US MH: 1522056	DS MH: 1522651	Number of Segments: 9	Test Length: 1,922'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: JDE	Comments: CNF 1522059	
FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)			

N

1522056
231'
1522467
375'
1522466
47'
SEVEN MILE CR.
1522059 (CNF)
167'±
1521610
317'
1522465
256'
1521648
1521296
218'
1521295
217'
1521294
1522651
32'
* A5 * A4 * A3 * A2 * A1 * A8 * A9
3815 3813 3803 3804 3807 3705 3703 3615
A7 A6 LOT # 3609

CREW COMMENTS

- CNF 1522059
- DUT GOING LINE FROM 1522466 HAS STICKS CREATING A GRAVE BLOCKAGE. HAD TO SET UP SMOKE BLOWER ON 1522467

Last Revised 9/16/2004

Leader Form

Sketch No: 276

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\276.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	276	Date:	10/12/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	5	Setup No:	1	Priority CCTV:	

House Number	3803	Street Prefix:		Street Name:	Seven Mile	Street Type:	LANE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate		
Sector:	2=Private	Drainage Area:	50				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 9

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1012-2004\T-3\PLAYER_A\A_2004_1012Image0009.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.

SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

Page 1 of 2
Smoke Set No. 26
Setup No. 1

276

TEST LOCATION				
Project: WRPA	Sewershed: Jones Falls	Date: 10-12-04	Start Time: 1345	
Crew: T3	Street Location: SEVEN MILE C.W.			
US MH: 1522056	DS MH: 1522651	Number of Segments: 9	Test Length: 1,922'	
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 (3)	Ground: (Dry) Moderate Wet	
Plugs Removed? Y (N)	Recorder: JMC [Signature]	Comments: CNF 1522059		
FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)				

CREW COMMENTS

- CNF 1522059
- OUT GOING LINE FROM 1522462 HAS STICKS CREATING A GRAVE BLOCKAGE. HAD TO SET UP SMOKE BLOWER ON 1522462

Last Revised 9/16/2004

Leader Form

Sketch No: 276

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\276.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	276	Date:	10/12/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	6	Setup No:	1	Priority CCTV:	

House Number	3813	Street Prefix:		Street Name:	Seven Mile	Street Type:	LANE
Source Type:	18= Other	Location:	14=Other	Severity:	1=No Smoke		
Sector:	2=Private	Drainage Area:	0				
Comments:							

SMOKE TEST PHOTOS



Photo No:
Filename Path:

Image Status: No image name specified.

Photo No: 10

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1012-2004\T-3\PLAYER_A\A_2004_1012Image0010.JPG

Image Status: Image found and displayed.

Photo No:
Filename Path:

Image Status: No image name specified.

SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 26
Setup No. 1

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

276

TEST LOCATION				
Project: WRPA	Sewershed: Jones Falls	Date: 10-12-04	Start Time: 1345	
Crew: T3	Street Location: SEVEN MILE C.W.			
US MH: 1522056	DS MH: 1522651	Number of Segments: 9	Test Length: 1,922'	
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet	
Plugs Removed? Y (N)	Recorder: JAA [Signature]	Comments: CNF 1522059		
FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)				

N

1522056
231'
1522467
375'
1522059 (CNF)
1521610
317'
1522467
256'
1521608
1521296
218'
1521295
217'
1521294
32'
1522651
SEVEN MILE C.W.
STICK BLOCKAGE
167'
3815
3813
3803
3801
3795
3703
3615
3609
LOT # 3609

CREW COMMENTS

- CNF 1522059
- OUT GOING LINE FROM 1522467 HAS STICKS CREATING A GREAT BLOCKAGE. HAD TO SET UP SMOKE BLOWER ON 1522467

Last Revised 9/16/2004

Leader Form

Sketch No: 276

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\276.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	276	Date:	10/12/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	7	Setup No:	1	Priority CCTV:	

House Number	3815	Street Prefix:		Street Name:	Seven Mile	Street Type:	LANE
Source Type:	18= Other	Location:	14=Other	Severity:	1=No Smoke		
Sector:	2=Private	Drainage Area:	0				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 11

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1012-2004\T-3\PLAYER_A\A_2004_1012Image0011.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY


Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 26
Setup No. 1
276

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-12-04	Start Time: 1345
Crew: T3	Street Location: SEVEN MILE CR.		
US MH: 1522056	DS MH: 1522651	Number of Segments: 9	Test Length: 1,922'
Plugged US: Y <u>N</u>	Plugged DS: Y <u>N</u>	# of Blowers: 1 2 <u>3</u>	Ground: <u>Dry</u> Moderate Wet
Plugs Removed? Y <u>N</u>	Recorder: <i>[Signature]</i> JDE P. H. 2004	Comments: CNF 1522059	
FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)			

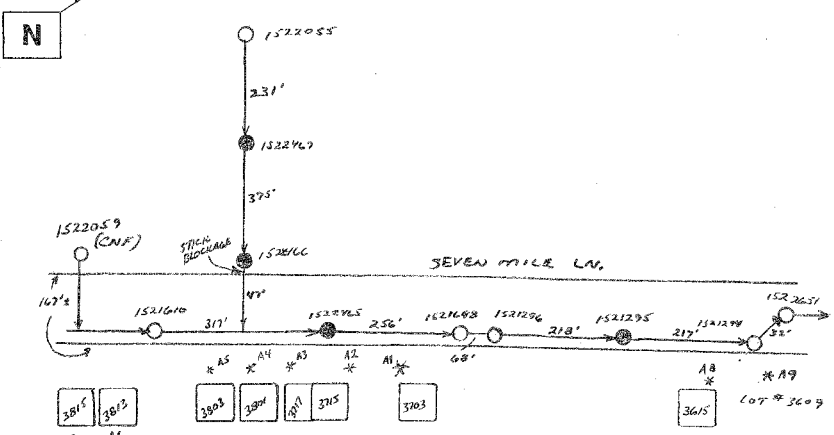

CREW COMMENTS

• CNF 1522059

• OUT GOING LINE FROM 1522466 HAS STICKS CREATING A GRAVIL BLOCKAGE. HAD TO SET UP SMOKE BLOWER ON 1522467

Last Revised 9/16/2004Leader Form

Sketch No:

276

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\276.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	276	Date:	10/12/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	8	Setup No:	1	Priority CCTV:	

House Number	3615	Street Prefix:		Street Name:	Seven Mile	Street Type:	LANE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate		
Sector:	2=Private	Drainage Area:	20				
Comments:							

SMOKE TEST PHOTOS

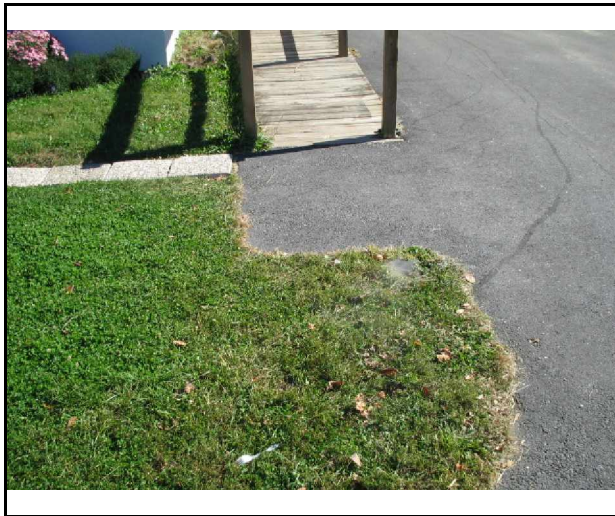


Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 12

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1012-2004\T-3\PLAYER_A\A_2004_1012Image0012.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 26
Setup No. 1
276

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-12-04	Start Time: 1345
Crew: T3	Street Location: SEVEN MILE CR.		
US MH: 1522056	DS MH: 1522651	Number of Segments: 9	Test Length: 1,922'
Plugged US: Y <u>N</u>	Plugged DS: Y <u>N</u>	# of Blowers: 1 2 <u>3</u>	Ground: <u>Dry</u> Moderate Wet
Plugs Removed? Y <u>N</u>	Recorder: <i>[Signature]</i> JDE P. H. 2004	Comments: CNF 1522059	
FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)			

CREW COMMENTS

• CNF 1522059

• OUT GOING LINE FROM 1522467 HAS STICKS CREATING A GRAVIL BLOCKAGE. HAD TO SET UP SMOKE BLOWER ON 1522467

Last Revised 9/16/2004Leader Form

Sketch No:

276

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\276.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	276	Date:	10/12/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	9	Setup No:	1	Priority CCTV:	

House Number	3609	Street Prefix:		Street Name:	Seven Mile	Street Type:	LANE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major		
Sector:	2=Private	Drainage Area:	20				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 13

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1012-2004\T-3\PLAYER_A\A_2004_1012Image0013.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 26
Setup No. 1
276

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-12-04	Start Time: 1345
Crew: T3	Street Location: SEVEN MILE CR.		
US MH: 1522056	DS MH: 1522651	Number of Segments: 9	Test Length: 1,922'
Plugged US: Y <u>N</u>	Plugged DS: Y <u>N</u>	# of Blowers: 1 2 <u>3</u>	Ground: <u>Dry</u> Moderate Wet
Plugs Removed? Y <u>N</u>	Recorder: <i>[Signature]</i> JDE P. 10/12/04	Comments: CNF 1522059	
FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)			

CREW COMMENTS

• CNF 1522059

• OUT GOING LINE FROM 1522466 HAS STICKS CREATING A GRAVITY BLOCKAGE. HAD TO SET UP SMOKE BLOWER ON 1522467

Last Revised 9/16/2004Leader Form

Sketch No:

276

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\276.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	277	Date:	10/12/2004	MeterBasin:	
Observer ID:		Crew:	T-3	Dye Test Recommended:	N
Defect No:	0	Setup No:	2	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
---------------------	-----------------------	---------------------	---------------------

Source Type:	Location:	Severity:
Sector:	Drainage Area: 0	
Comments: No defects observed		

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 26
Setup No. 2
277

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WSPA	Sewershed: Jones Falls	Date: 10-12-04	Start Time: 1645
Crew: T3	Street Location: SCALE VILLAGE OF PARK HEIGHTS AV	7400 ~ 7458	
US MH: 1520703	DS MH: 1520659	Number of Segments: 6	Test Length: 713'
Plugged US: <input checked="" type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> N	# of Blowers: 1 (2) 3	Ground: <input checked="" type="checkbox"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="checkbox"/> N	Recorder: JSE MIAWETTS	Comments: CNF 1520700 + 701	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

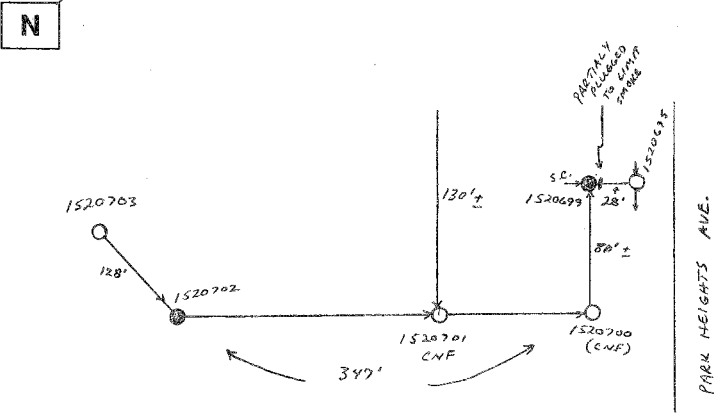

CREW COMMENTS

• COULD NOT OPEN 1520695 SIDEWALK CONCRETE IS POURED ON IT.

• BLOWING SMOKE FROM M.H 1520699 ONLY, AND SMOKE WAS GETTING UP PAST M.H 1520701 AREA, AND WHEN BLOWING SMOKE IN 1520702 NO SMOKE GOT DOWN PAST THE AREA OF 1520700. PROBABLE BLOCKAGE IN THIS M.H AREA BUT IT COULD NOT BE FOUND.

Leader Form

Sketch No:

277

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\277.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	277	Date:	10/12/2004	MeterBasin:	
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	0	Setup No:	2	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
---------------------	-----------------------	---------------------	---------------------

Source Type:	Location:	Severity:
Sector:	Drainage Area: 0	
Comments: No defects observed		

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 26
Setup No. 2
277

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WSPA	Sewershed: Jones Falls	Date: 10-12-04	Start Time: 1645
Crew: T3	Street Location: SCALE VILLAGE OF PARK HEIGHTS AV	7400 ~ 7458	
US MH: 1520703	DS MH: 1520659	Number of Segments: 6	Test Length: 713'
Plugged US: <input checked="" type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> N	# of Blowers: 1 (2) 3	Ground: <input checked="" type="checkbox"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="checkbox"/> N	Recorder: JSE MIAWETTS	Comments: CNF 1520700 + 701	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

• COULD NOT OPEN 1520695 SIDEWALK CONCRETE IS POURED ON IT.

• BLOWING SMOKE FROM M.H 1520699 ONLY, AND SMOKE WAS GETTING UP PAST M.H 1520701 AREA, AND WHEN BLOWING SMOKE IN 1520702 NO SMOKE GOT DOWN PAST THE AREA OF 1520700. PROBABLE BLOCKAGE IN THIS M.H AREA BUT IT COULD NOT BE FOUND.

Leader Form

Sketch No:

277

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\277.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	278	Date:	10/13/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	0	Setup No:	1	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
---------------------	-----------------------	---------------------	---------------------

Source Type:	Location:	Severity:
Sector:	Drainage Area: 0	
Comments: No defects observed		

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 27
Setup No. 1
278

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 0755
Crew: T2	Street Location: Shock Ave		
US MH: 1520697	DS MH: 1520694	Number of Segments: 3	Test Length: 1056'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: (Dry) Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments: —	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 278

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\278.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	279	Date:	10/13/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	1	Setup No:	2	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
7240		Park Heights	AVE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 526

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0526.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 27
Setup No. 2
279

 **BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1030
Crew: T2	Street Location: Park Heights Ave		
US MH: 1522651	DS MH: 1522697	Number of Segments: 4	Test Length: 1265'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: (Dry) Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blomk	Comments: _____	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

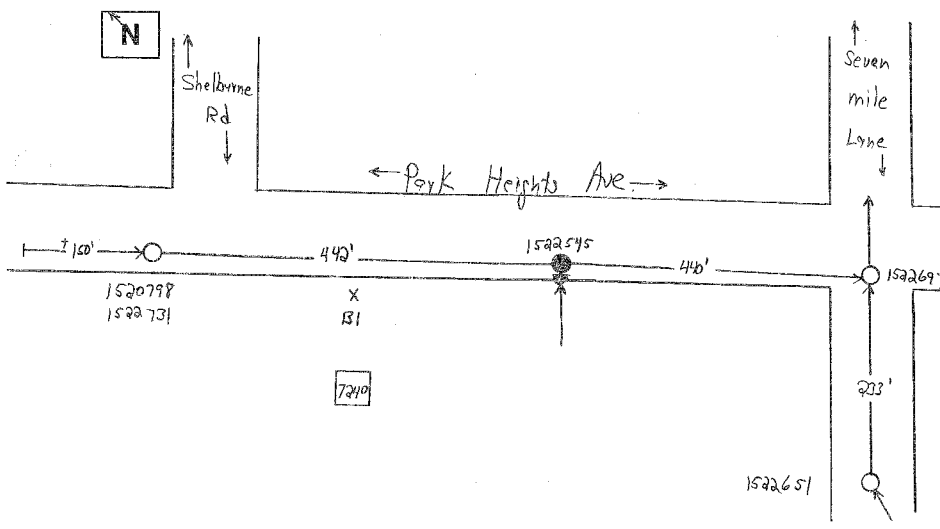

CREW COMMENTS

Last Revised 9/16/2004 Leader Form

Sketch No: 279

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\279.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	280	Date:	10/13/2004	MeterBasin:	01_WR32
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	1	Setup No:	3	Priority CCTV:	

House Number	3622	Street Prefix:		Street Name:	Glengyle	Street Type:	AVE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major		
Sector:	2=Private	Drainage Area:	0				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 527

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0527.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 27
Setup No. 3
280(27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1115
Crew: T2	Street Location: Glenyle Ave		
US MH: 1521713	DS MH: 1522722	Number of Segments: 6	Test Length: 1655'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

315 is a CB that had very very heavy smoke. The grate covering the CB can not be removed to access the storm line for lamping. 2 Lines & a drainage ditch flow to the CB.

Leader Form

Sketch No:

280

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\280.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	280	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	Y
Defect No:	10	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:		
7116		Park Heights	AVE		
Source Type:	14= Catch Basin	Location:	9=Yard-Side	Severity:	2=Trace
Sector:	1=Public	Drainage Area:	7000		
Comments:	west corner				

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 536

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0536.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 27
Setup No. 3
280(27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1115
Crew: T2	Street Location: Glenyle Ave		
US MH: 1521713	DS MH: 1522722	Number of Segments: 6	Test Length: 1655'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

S15 is a CB that had very very heavy smoke. The grate covering the CB can not be removed to access the storm line for lamping. 2 Lines & a drainage ditch flow to the CB.

Last Revised 9/16/2004 Leader Form

Sketch No:

280

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\280.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	280	Date:	10/13/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	11	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
7121		Park Heights	AVE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 535

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0535.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 27
Setup No. 3
280(27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1115
Crew: T2	Street Location: Glenyle Ave		
US MH: 1521713	DS MH: 1522722	Number of Segments: 6	Test Length: 1655'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

315 is a CB that had very very heavy smoke. The grate covering the CB can not be removed to access the storm line for lamping. 2 Lines & a drainage ditch flow to the CB.

Last Revised 9/16/2004 Leader Form

Sketch No:

280

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\280.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	280	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	12	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:		
7116		Park Heights	AVE		
Source Type:	02= Service Line	Location:	7=Yard-Front	Severity:	2=Trace
Sector:	2=Private	Drainage Area:	9		
Comments:					

SMOKE TEST PHOTOS

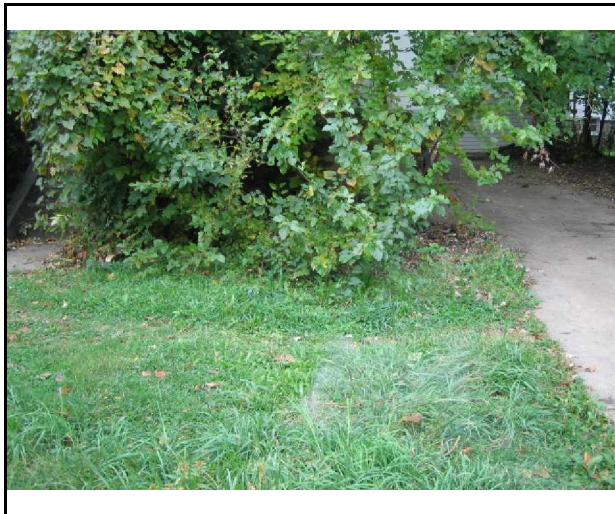


Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 537

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0537.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 27
Setup No. 3
280(27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1115
Crew: T2	Street Location: Glenlyle Ave		
US MH: 1521713	DS MH: 1522722	Number of Segments: 6	Test Length: 1655'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

S15 is a CB that had very very heavy smoke. The grate covering the CB can not be removed to access the storm line for lamping. 2 Lines & a drainage ditch flow to the CB.

Last Revised 9/16/2004
Leader Form

Sketch No:

280

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\280.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	280	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	13	Setup No:	3	Priority CCTV:	

House Number	7116	Street Prefix:		Street Name:	Park Heights	Street Type:	AVE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major		
Sector:	2=Private	Drainage Area:	0				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 538

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0538.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 27
Setup No. 3
280(27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1115
Crew: T2	Street Location: Glenlyle Ave		
US MH: 1521713	DS MH: 1522722	Number of Segments: 6	Test Length: 1655'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

315 is a CB that had very very heavy smoke. The grate covering the CB can not be removed to access the storm line for lamping. 2 Lines & a drainage ditch flow to the CB.

Last Revised 9/16/2004 Leader Form

Sketch No:

280

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\280.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.